Rat Rig

00. BOM & Machine Critical Dimensions

Written By: Rat Rig

	Machine Volume								
Version	X (mm)	Y (mm)	Z (mm)						
55	644.1	644.1	525.7						
75	894.1	894.1	525.7						
1075	894.1	1144.1	525.7						
1050	644.1	1144.1	525.7						
1010	1144.1	1144.1	525.7						
1510	1144.1	1644.1	525.7						
1515	1644.1	1644.1	525.7						

	Working volume							
Version	X (mm)	Y (mm)	Z* (mm) 113					
55	281	288						
75	531	538	113					
1075	531	788	113					
1050	281	788	113					
1010	781	788	113					
1510	781	1288	113					
1515	1281	1288	113					

^{*} With no spoilerboard

Spoi	Spoiler board dimensions							
Version	X (mm)	Y (mm)						
55	346	500						
75	596	750						
1075	596	1000						
1050	346	1000						
1010	846	1000						
1510	846	1500						
1515	1346	1500						

INTRODUCTION

Full Machine BOM

Upgrade Kit BOM

STL Files for Printed Parts

Step 1 — Critical Dimensions

	Machine Volume							
Version	X (mm)	Y (mm)	Z (mm)					
55	644.1	644.1	525.7					
75	894.1	894.1	525.7					
1075	894.1	1144.1	525.7					
1050	644.1	1144.1	525.7					
1010	1144.1	1144.1	525.7					
1510	1144.1	1644.1	525.7					
1515	1644.1	1644.1	525.7					

Working volume							
Version	X (mm)	Y (mm)	Z* (mm)				
55	281	288	113				
75	531	538	113				
1075	531	788	113				
1050	281	788	113				
1010	781	788	113				
1510	781	1288	113				
1515	1281	1288	113				

^{*} With no spoilerboard

Spoiler board dimensions					
Version	X (mm)	Y (mm)			
55	346	500			
75	596	750			
1075	596	1000			
1050	346	1000			
1010	846	1000			
1510	846	1500			
1515	1346	1500			

Click image to enlarge.

Step 2 — Organize your profiles and Lead Screws

KillerBee Variant (X/Y)	Lengnts (mm)													
	55	Qty	1050	Qty	7575	Qty	1075	Qty	1010	Qty	1510	Qty	1515	Qty
Z-Gantry C-Beam	250	1	250	1	250	1	250	1	250	1	250	1	250	1
X-Gantry C-Beam	500	1	500	1	750	1	750	1	1000	1	1000	1	1500	1
Y Axis C-Beam	500	2	1000	2	750	2	1000	2	1000	2	1500	2	1500	2
X-Gantry 2040 (Tapped)	500	1	500	1	750	1	750	1	1000	1	1000	1	1500	1
X Base 2040 (Tapped)	495	2	495	2	745	2	745	2	995	2	995	2	1495	2
Y Spoiler Support 2040	460	2	960	2	710	3	960	3	960	4	1460	4	1460	5
X Lead Screw	557	1	557	1	807	1	807	1	1057	1	1057	1	1557	1
Y Lead Screw	557	2	1057	2	807	2	1057	2	1057	2	1557	2	1557	2
Z Lead Screw	281	1	281	1	281	1	281	1	281	1	281	1	281	1

Since there are multiple KillerBee variants, our guides won't mention profile and lead screw lengths, as these vary. Instead, the guide will refer to each profile and lead screw by the names described on the table. You may want to label/group these parts right now to prevent assembly mistakes and make your job easier.